



# **SNS COLLEGE OF TECHNOLOGY**

**An Autonomous Institution**  
**Coimbatore-35**



Accredited by NBA – AICTE and Accredited by NAAC – UGC with 'A+' Grade  
Approved by AICTE, New Delhi & Affiliated to Anna University, Chennai

## **DEPARTMENT OF ELECTRONICS & COMMUNICATION ENGINEERING**

IYEAR/ II SEMESTER

### **23ECT101 Basics of Electrical Engineering and Instrumentation**


#### **TOPIC -VARIABLE INDUCTANCE TRANSDUCER-LVDT**



# Linear Variable Differential Transformer



The term **LVDT** stands for the **Linear Variable Differential Transformer**. It is the most widely used inductive transducer that converts the linear motion into the electrical signal

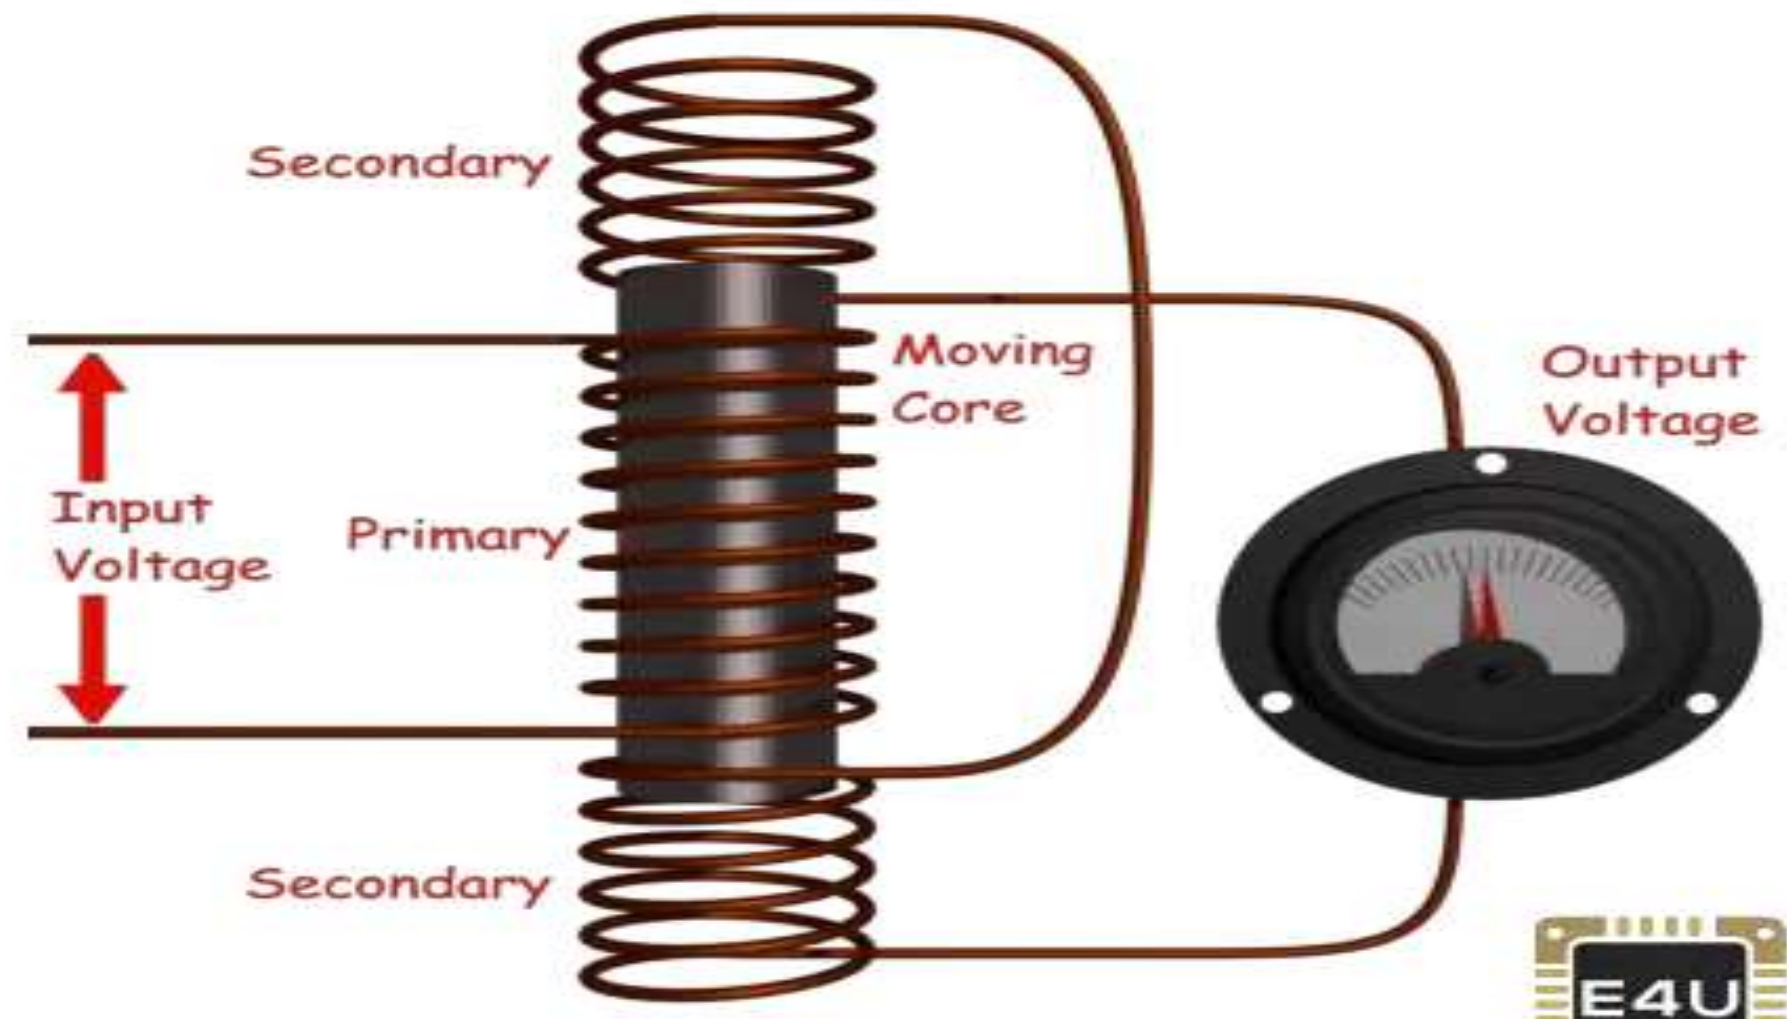




- The transformer consists of a primary winding P and two secondary windings  $S_1$  and  $S_2$  wound on a cylindrical former (which is hollow in nature and contains the core).
- Both the secondary windings have an equal number of turns, and we place them on either side of primary winding
- The primary winding is connected to an AC source which produces a flux in the air gap and voltages are induced in secondary windings.
- A movable soft iron core is placed inside the former and displacement to be measured is connected to the iron core.
- The LVDT is placed inside a stainless steel housing because it will provide electrostatic and electromagnetic shielding.
- Both the secondary windings are connected in such a way that resulted output is the difference between the voltages of two windings.



# WORKING PRINCIPLE

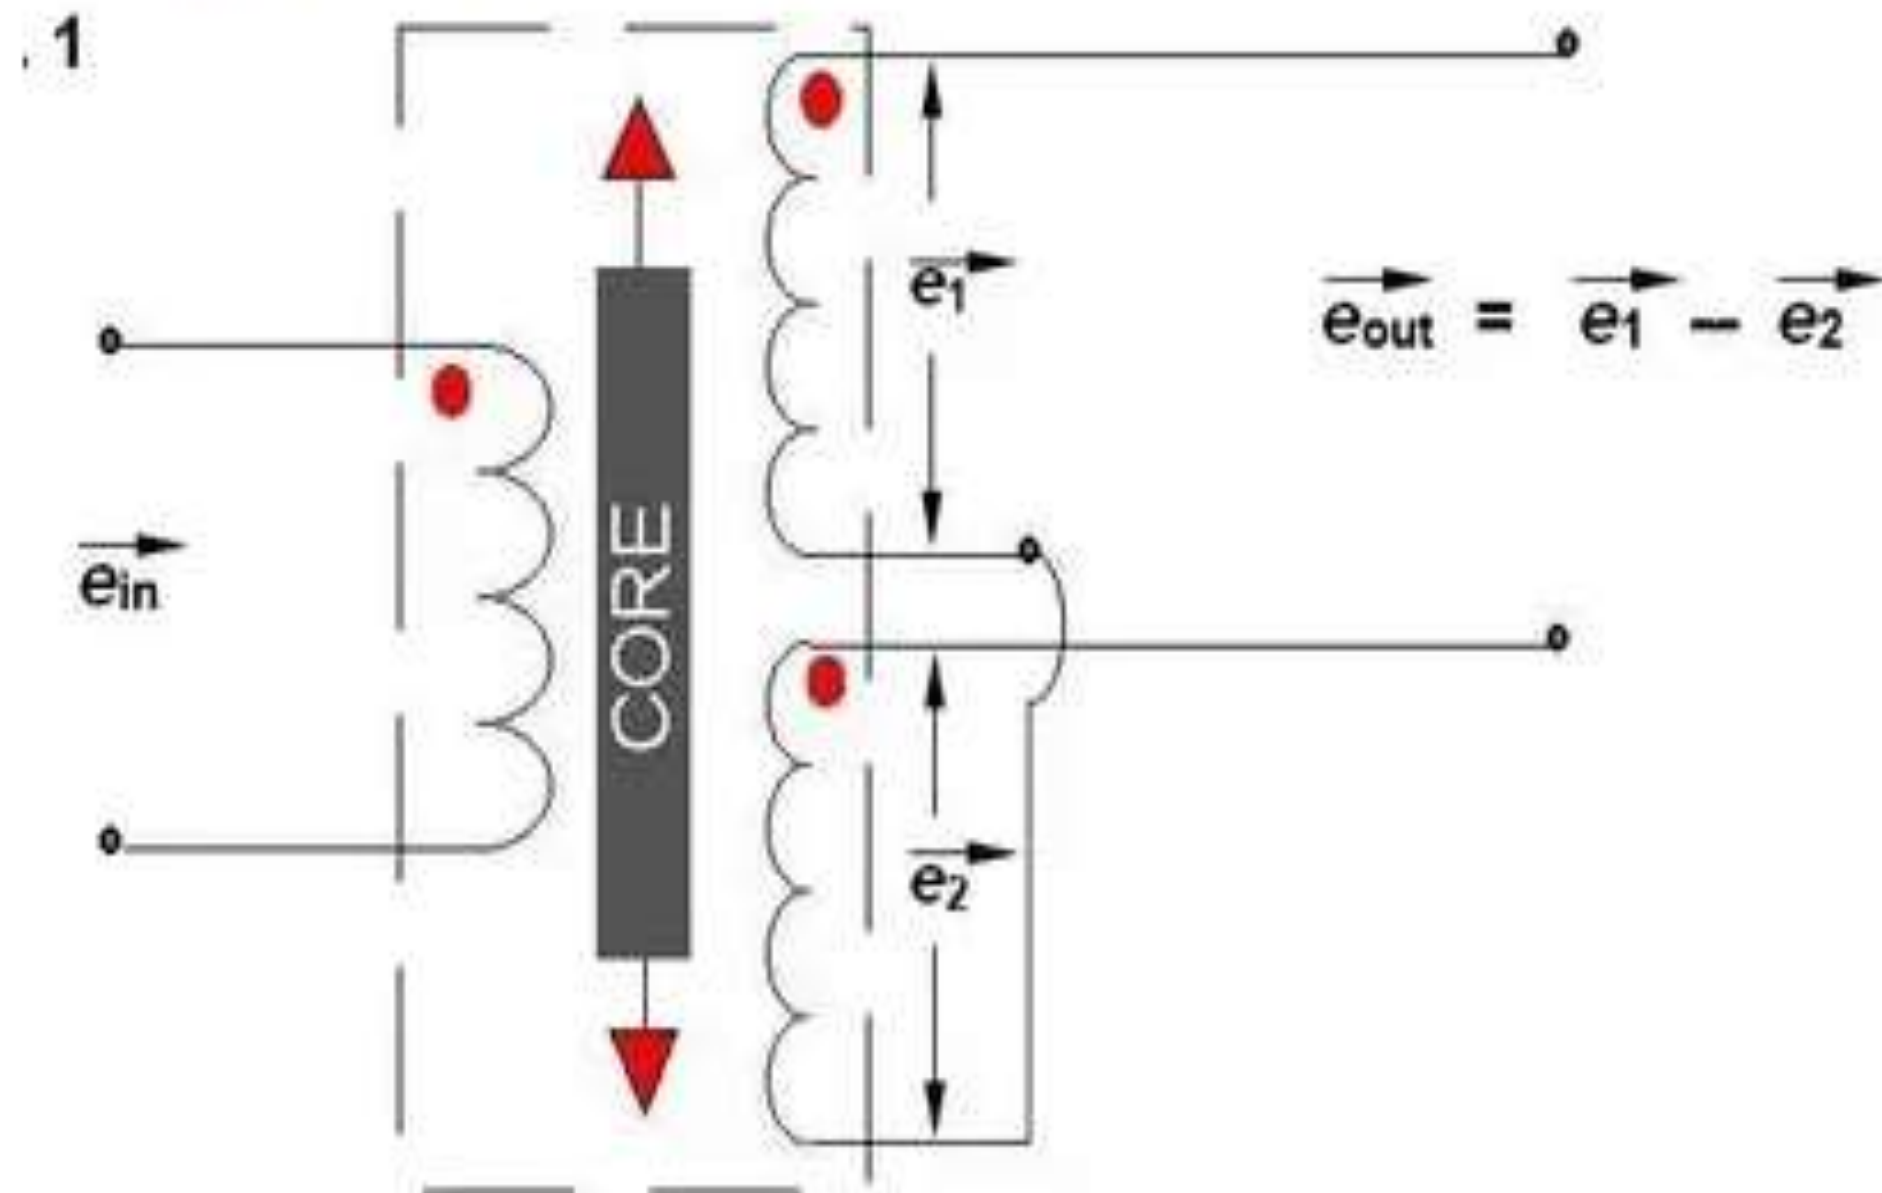



As the primary is connected to an AC source so alternating current and voltages are produced in the secondary of the LVDT. The output in secondary  $S_1$  is  $e_1$  and in the secondary  $S_2$  is  $e_2$ . So the differential output is,

$$e_{\text{out}} = e_1 - e_2$$

**CASE I When the core is at null position** (for no displacement)

When the core is at null position then the flux linking with both the secondary windings is equal so the induced emf is equal in both the windings. So for no displacement the value of output  $e_{\text{out}}$  is zero as  $e_1$  and  $e_2$  both are equal. So it shows that no displacement took place.

**CASE II When the core is moved to upward of null position** (For displacement to the upward of reference point)

In the this case the flux linking with secondary winding  $S_1$  is more as compared to flux linking with  $S_2$ . Due to this  $e_1$  will be more as that of  $e_2$ . Due to this output voltage  **$e_{\text{out}}$  is positive.**

**CASE III When the core is moved to downward of Null position** (for displacement to the downward of the reference point).

In this case magnitude of  $e_2$  will be more as that of  $e_1$ . Due to this output  **$e_{\text{out}}$  will be negative**



The amount of change in voltage either negative or positive is proportional to the amount of movement of core and indicates amount of linear motion.

By noting the output voltage increasing or decreasing the direction of motion can be determined

The output voltage of an LVDT is linear function of core displacement .

### **Advantages of LVDT**

**High Range** – The LVDTs have a very high range for measurement of displacement.they can used for measurement of displacements ranging from 1.25 mm to 250 mm

**No Frictional Losses** – As the core moves inside a hollow former so there is no loss of displacement input as frictional loss so it makes LVDT as very accurate device.

**High Input and High Sensitivity** – The output of LVDT is so high that it doesn't need any amplification. The transducer possesses a high sensitivity which is typically about 40V/mm.

**Low Hysteresis** – LVDTs show a low hysteresis and hence repeatability is excellent under all conditions

**Low Power Consumption** – The power is about 1W which is very small as compared to other transducers.

**Direct Conversion to Electrical Signals** – They convert the linear displacement to electrical voltage which are easy to process



## Disadvantages of LVDT

LVDT is sensitive to stray magnetic fields so it always requires a setup to protect them from stray magnetic fields.

LVDT gets affected by vibrations and temperature.

## Applications of LVDT

- We use LVDT in the applications where displacements to be measured are ranging from a fraction of mm to few cms.
- The **LVDT** acting as a primary transducer converts the displacement to electrical signal directly.
- The LVDT can also act as a secondary transducer. E.g. the Bourbon tube which acts as a primary transducer and it converts pressure into linear displacement and then LVDT converts this displacement into an electrical signal which after calibration gives the readings of the pressure of fluid.
- measure fluid levels, inspect assembly lines , power turbines etc



# THANK YOU